



Project: Greenacres School	Date: 10/24/19
Address: 41 Huntington Avenue, Scarsdale NY 10583	Job ID/ MU#:
Client: Park East Construction	Weather: Cloudy

Inspection Type: Noise and Dust Monitoring	Contractor: Park East
Present At Site: 7:00AM	Sub-Contractor:
General Area: Northern Yard of School	CM/Designer:
Specific Location: Northern Side of school 1st, 2nd floor, Basement	
Last Inspection:	Building Code Section:
Reviewed	Drawings:
Approved	Submittals
	Other:

Deficiency:	Resolution:			
Request For Information:				
Non-Conformance Report:				
RFI # : ☐ Issued	RFI # : ☐ Answered	NCR # : ☐ Issued	NCR # : ☐ Resolved	NCR # : ☐ Open
Observations/Notes:				

Noise caused by ongoing construction in the perimeter of the school was monitored using a sound level meter. Readings were taken in the basement hallway (20 feet from construction), next to the work performed today.

An Average noise level of 57.60 dB was measured for the day

Dust Levels within the Perimeter of the school were measured. These Readings can be found in the chart on the next page. Daily PM2.5 density = 2.2, PM10 density = 4.2

Work today included: Excavating dirt (CAT360), Delivery of 3" stones, removal of soil/forms

Attachments/Photos:

Time on site: 7:00 AM	Time off site: 3:30 PM
Inspected Work Satisfactory (Except As Noted): ☒ No: ☐	Re-inspection Required: ☐ Work Completed: ☐

Inspector: **Erald Hysaj** Signature:  Certification:

NOTICE: The field representative is on site solely to observe operation of the contractor identified, for the work identified and it's conformance to the contract documents, and report those operations to the client. The presence and activities of the field representative do not relieve the contractor's obligation to meet contractual requirements. The contractor retains sole responsibility for site safety and means/methods of construction sequences. The field representative is not responsible for identifying errors and omissions in the contract documents. Rev.11/14/17



MUNICIPAL
TESTING LABORATORY, INC.

375 RABRO DRIVE, HAUPPAUGE NY 11788
• TEL: (631) 761-5555 • www.mtllab.net
NYC DoB Special Inspection Agency #0230

INSPECTION REPORT

REPORT #

PHOTOS TAKEN


Page of

Date	Time	Location	Sample	2.5 microns	10 microns	Temp	RH%
October 24, 2019	08:08	BASEMENT	1	0	1	68.1	47.8
	08:14	1ST FLOOR	2	1	2	68.9	48.4
	08:20	2ND FLOOR	3	2	4	70.1	49.1
	09:43	2ND FLOOR STORAGE	4	4	6	70.4	51.2
	09:49	CAFETERIA	5	2	5	73.0	52.3
	09:55	BASEMENT	6	0	1	71.8	52.1
	10:00	1ST FLOOR	7	2	6	73.5	53.0
	10:05	2ND FLOOR	8	4	6	74.5	56.9
	10:11	2ND FLOOR STORAGE	9	5	7	75.1	57.1
	11:43	SAGE TERRACE	10	2	4	70.1	50.0
	11:49	PUTNAM ROAD	11	2	5	70.8	49.1
	11:55	HUNTINGTON AVENUE	12	1	4	70.4	50.4
	12:00	BASEMENT	13	3	8	73.4	58.1
	12:05	1ST FLOOR	14	0	1	74.0	59.0
	12:11	2ND FLOOR	15	4	9	73.0	57.1
	13:43	BASEMENT	16	1	2	72.8	58.2
	13:49	1ST FLOOR	17	0	0	74.1	58.1
	13:55	2ND FLOOR	18	3	6	74.1	59.0
	14:00	2ND FLOOR STORAGE	19	4	6	75.4	54.1
	14:05	CAFETERIA	20	5	7	75.1	61.3
	14:11	1ST FLOOR	21	1	3	75.5	55.8

NOTICE


The field representative is on site solely to observe operation of the contractor identified, for the work identified and it's conformance to the contract documents, and report those operations to the client. The presence and activities of the field representative do not relieve the contractor's obligation to meet the contractual requirements. The contractor retains sole responsibility for site safety and means/methods of construction success. The field representative is not responsible for identifying errors and omissions in the contract documents.

Standard Sound Level Meter RealTime Graph
Time: 2019-10-24 14:46:51

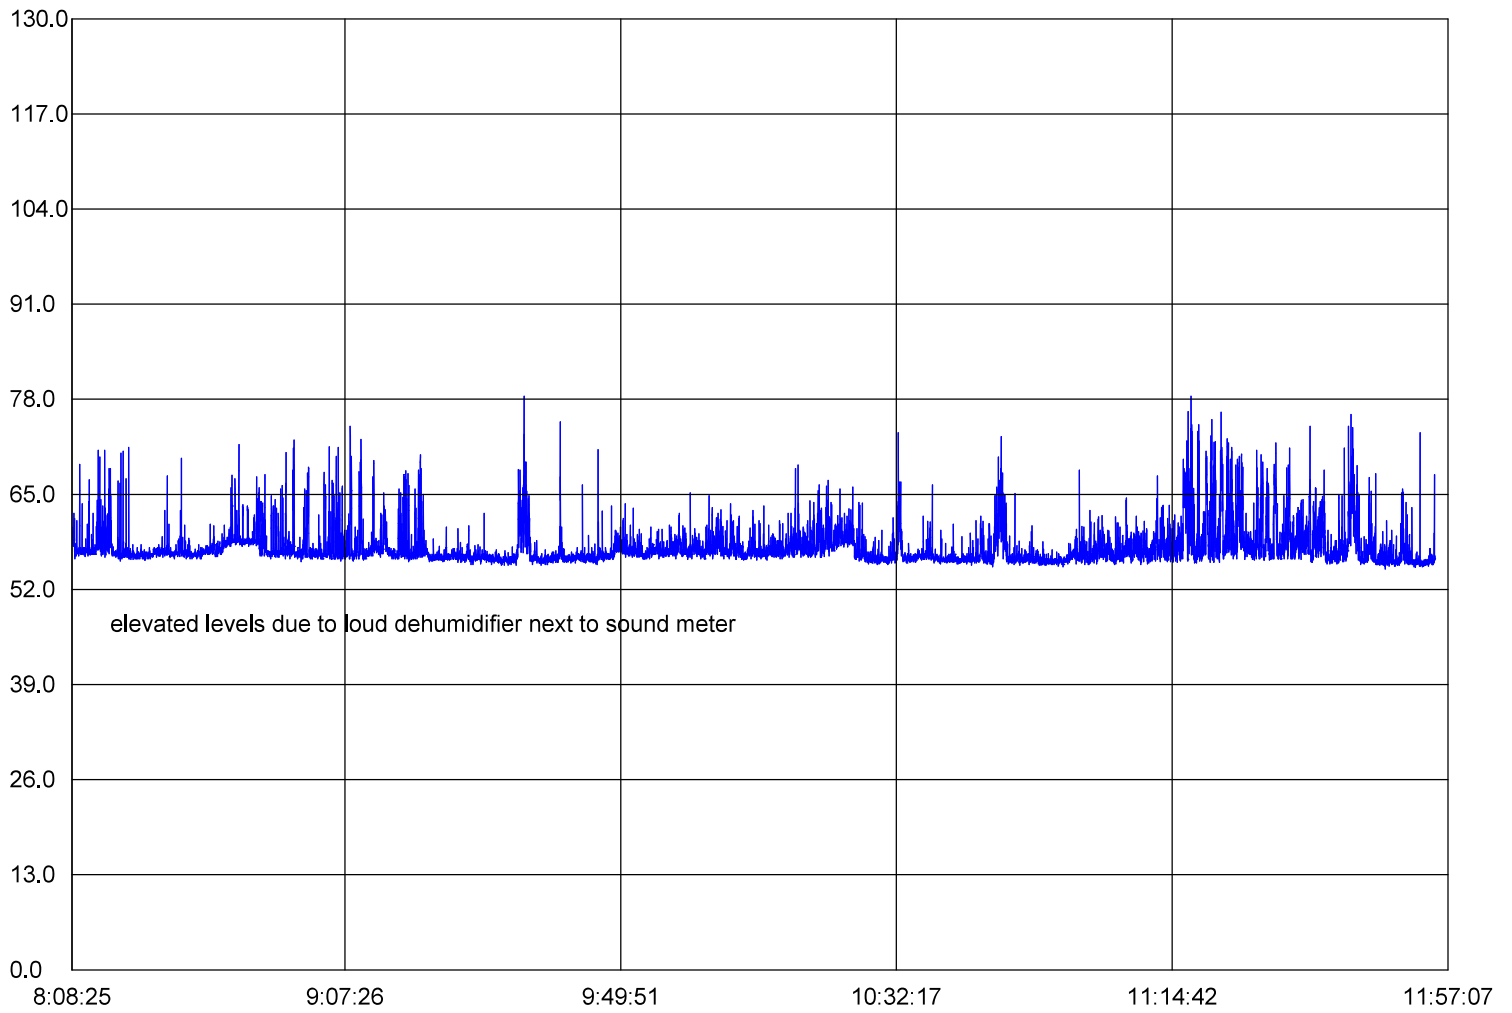

Start Time: 24-10-2019,8:08:25
Maxnum: 78.40 24-10-2019,9:35:00
Minnum: 54.80 24-10-2019,11:47:29
Sample Rate: 1.00
Average: 57.79

Standard Sound Level Meter RealTime Graph
Time: 2019-10-24 14:47:1

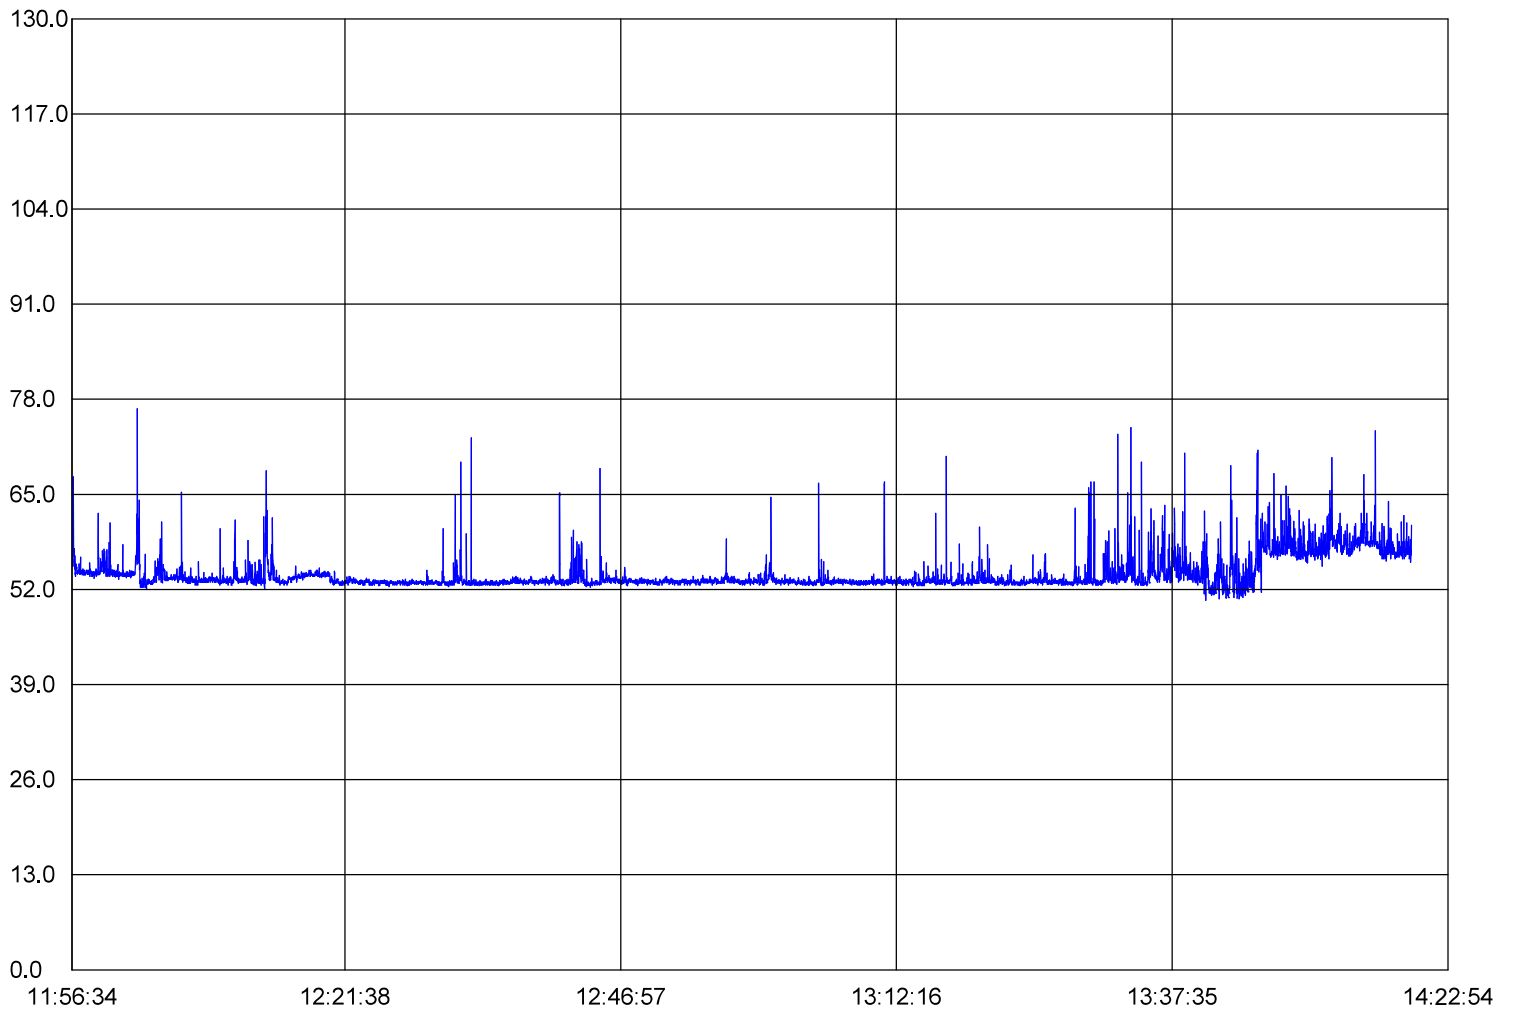

Start Time: 24-10-2019,11:56:34
Maxnum: 76.70 24-10-2019,12:02:35
Minnum: 50.50 24-10-2019,13:40:41
Sample Rate: 1.00
Average: 54.03

BASEMENT HALLWAY 2